

RHT32 Hygro-Thermometer Psychrometer

Simultaneously displays Air Temperature, Humidity and Wet Bulb or Dew Point

Features:


- Triple LCD display
- Turnable cap twists shut to protect the sensor during storage or travel
- °F/°C switchable
- Min/Max recalls highest and lowest readings
- Data Hold freezes the display
- Auto power off with disable
- Low battery indicator
- Optional external thermistor temperature probe
- Optional model complete with Certificate of Traceability to N.I.S.T.
- Includes (2) AAA batteries
- 2-year warranty

Applications:

Building inspection, water restoration, greenhouses, warehouses, museums, libraries, offices, storage areas

Specifications

Air Temperature	-4 to 122°F (-20 to 50°C)
Accuracy	±1.8°F/1°C
Relative Humidity	1 to 99.9%RH
Accuracy	±3%RH (10 to 90%)
Wet Bulb	-6.8 to 122°F (-21.6 to 50°C)
Dew Point	-109.6 to 122°F (-78.7 to 50°C)
Resolution	0.1°F/°C; 0.1%RH
Power	2 AAA Batteries
Dimensions	7 x 2 x 1" (178.5 x 48.4 x 24.7mm)
Weight	3.4oz (95g)

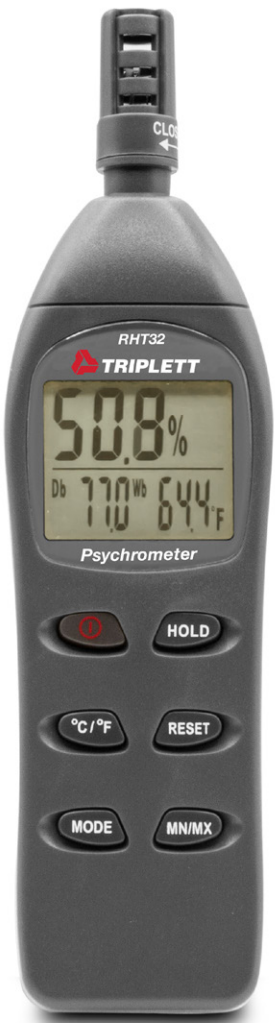

Ordering Information:

- RHT32 Hygro-Thermometer Psychrometer
RHT32-NIST RHT32 with certificate of NIST traceability

